


Vaporizer Part Number Consolidation

Vaporizer P/N 11A17 is no longer available and is now replaced by P/N 11A17-001. These two parts are similar, the only difference being the location of the fuel outlet plugs.

Each vaporizer has one inlet and three outlets:

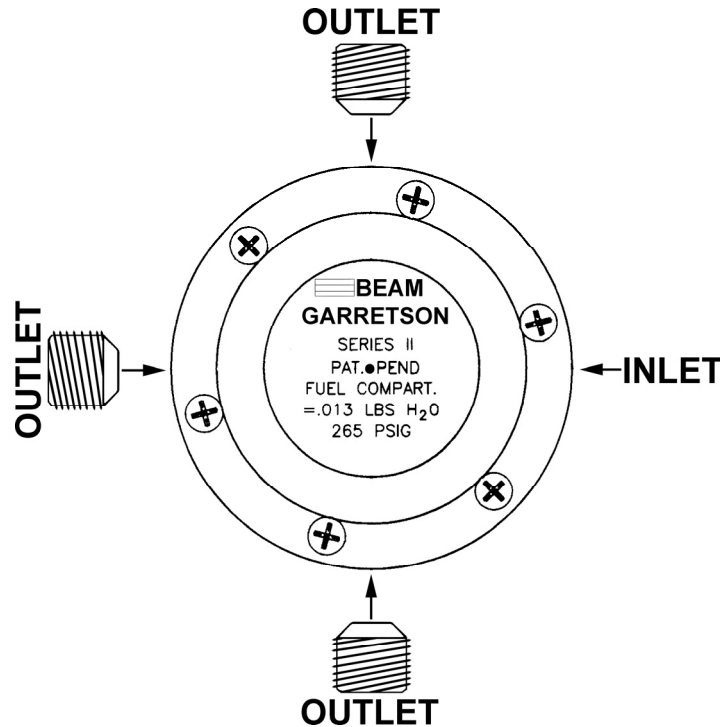

Top view of the 11A17-001 showing the inlet at the 3 o'clock position and three outlets at the 6, 9 and 12 o'clock positions.

The Vaporizer will come with plugs in two of its three fuel outlets. If it is necessary to relocate the fuel outlet connection, the plugs can be removed and relocated to fit the existing application. When installing the plugs, use Loctite 567 on the threads and torque to 100 in/lbs. (11.3 Nm).

If it was necessary to relocate one of the fuel outlet plugs, pressurize the regulator fuel inlet with 100 psi of air pressure and check the plugs for leakage with a commercial leak detector before placing the regulator in service.